

Test Report No.: SDHL1910019842FT Date: Nov.11, 2019 Page 1 of 3

SHANGHAI YANGLI FURNITURE MATERIAL CO., LTD. NO.1935 OF HUALING STREET, BAOSHAN DISTRICT, SHANGHAI CITY, CHINA

The following sample(s) was / were submitted and identified on behalf of the client as:

Sample Description : SLIM BOX DRAWER SYSTEM

Buyer Item No. : M03.105

Country of Origin : CHINA

Sample Receiving Date : Oct.31, 2019

Test Performing Date : Oct.31, 2019 to Nov.11, 2019

# **Test Result Summary**

Test(s) Requested	Result(s)	
Slide durability test with reference to clause 10 of ANSI/BIFMA X 5.5-2014	PASS	
Summary:		
1. For further details, please refer to the following page(s).		

Signed for and on behalf of Shunde Branch SGS-CSTC Co., Ltd.

Bill Wang

Approved signatory







| 作。| 「Paiding European Industrial Parts, Nat. 1 Sturtnet South Read, Wistre Section, Delaing Town, Shunde, Frisher, Georgiang Comp. Shunde, Frisher, Georgiang Comp. Section, Delaing Town, Shunde, Georgiang Comp. Section, Delaing Comp.



Test Report No.: SDHL1910019842FT Date: Nov.11, 2019 Page 2 of 3

### **TESTS AND RESULTS**

### **Test Conducted:**

Slide durability test with reference to clause 10 of ANSI/BIFMA X5.5-2014.

## No. of Sample:

1 set. For more sample information and pictures, please refer to the following page.

Test and Requirements	Test Results
Slide durability test  An extendible element on which the pair of tested sliders was mounted shall be uniformly loaded with the claimed load. A cycling device was attached to the extendible. The cycling device shall be set to cause the extendible element to travel within 0 to 6 mm (0 to 0.25 in.) of the closed position to 0 to 6 mm (0 to 0.25 in.) of the fully extended position and return. This amount of travel shall constitute one cycle. The cycling device shall not support or add vertical or horizontal loads to the suspensions.  The cycling device shall be operated at a rate of 12 ± 4 cycles per minute. The extendible element shall be subjected to 50,000 cycles. The suspensions shall not be cleaned or lubricated during the test.  During and after test, there shall be no loss of serviceability.	PASS

### Remark:

- 1. The total load of 30 kg and cyclic number of 50,000 cycles are specified by applicant;
- 2. The dimension of testing drawer is 530 mm (W) x 360 mm (D) x 105 mm (H);
- 3. For the sample information and pictures, please refer to the following page.



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <a href="http://www.sgs.com/en/Terms-and-Conditions.aspx">http://www.sgs.com/en/Terms-and-Conditions.aspx</a> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <a href="http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx">http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx</a>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forger or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention:To check the authenticity of testing / inspection report & certificate, please contact us at telephone:(86-755) 8307 1443, or email: CN.Doccheck@sgs.com

1443, or email: CN.Doccheck@sgs.com

1457 Ballingswindstidely this Sample Ballings Inspection from the Scatter of the Scatter of Scatter Inspection report & CRE-7571/20205888 | Mayer energy company company

| 作。| 「Building European Industrial Part, Na.1 Sturine South Read, Wistra Sextion, Dallaring Town, Shunde, Frishard, Guargdong, China 528333 t (86-757)22805888 f (86-757)22805888 www.sgs.group.com.cn 中国・广东・佛山市原徳区大良街道办事处五沙厩和南路1号欧洲工业园一号厂房首层 邮编: 528333 t (86-757)22805888 f (86-757)22805888 e sgs.china@sgs.com



**Test Report** No.: SDHL1910019842FT Date: Nov.11, 2019 Page 3 of 3

## **SAMPLE INFORMATION AND PICTURES**

Weight: 653.4 g/piece


Length: 345 mm


Other Dimensions: /

# Sample as Received





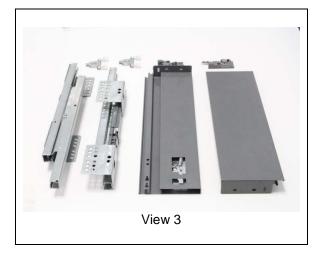

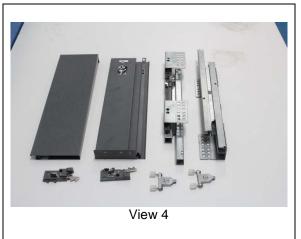

\*\*\*End of Report\*\*\*



1 Fr, Faulding, European Industrial Park, No. 1. Stumbe South Road, Washa Section, Dalaring Town, Shunde, Fisten, Guargotong, China 528333 t (86-757) 22805888 f (86-757) 22805858 www.sgsgroup.com.cn 中国·广东·佛山市原德区大良街道办事处五沙颠和南路1号欧洲工业园一号厂房首层 邮编: 528333 t (86-757)22805888 f (86-757)22805858 e sgs.china@sgs.com